

# RECORD OF SURVEY

Located in the SW 1/4 of Section 34, T9N, R42E and the NW 1/4 of Section 3, T8N R42E, Fremont County, Idaho

Job Name: Idaho Dept. of Fish & Game  
 Job Number: 2014-143  
 CoGo File: Idaho\_Fish\_Game\_2014-143

Drawn By: K.L.T.  
 Checked By: K.L.T.  
 Date: 12/26/2014  
 Revision No.  
 Scale: 1" = 100'



Sheet 1 Of 2


## CERTIFICATE OF SURVEY

I, Kevin L. Thompson, do hereby Certify that I am a Licensed Professional Land Surveyor in the State of Idaho, and that the attached plat was drawn from an actual Survey made on the ground under my direct supervision, and that this map is an accurate representation of said Survey.



December 26, 2014 10563  
 Date License No.

## RECORDER'S CERTIFICATE

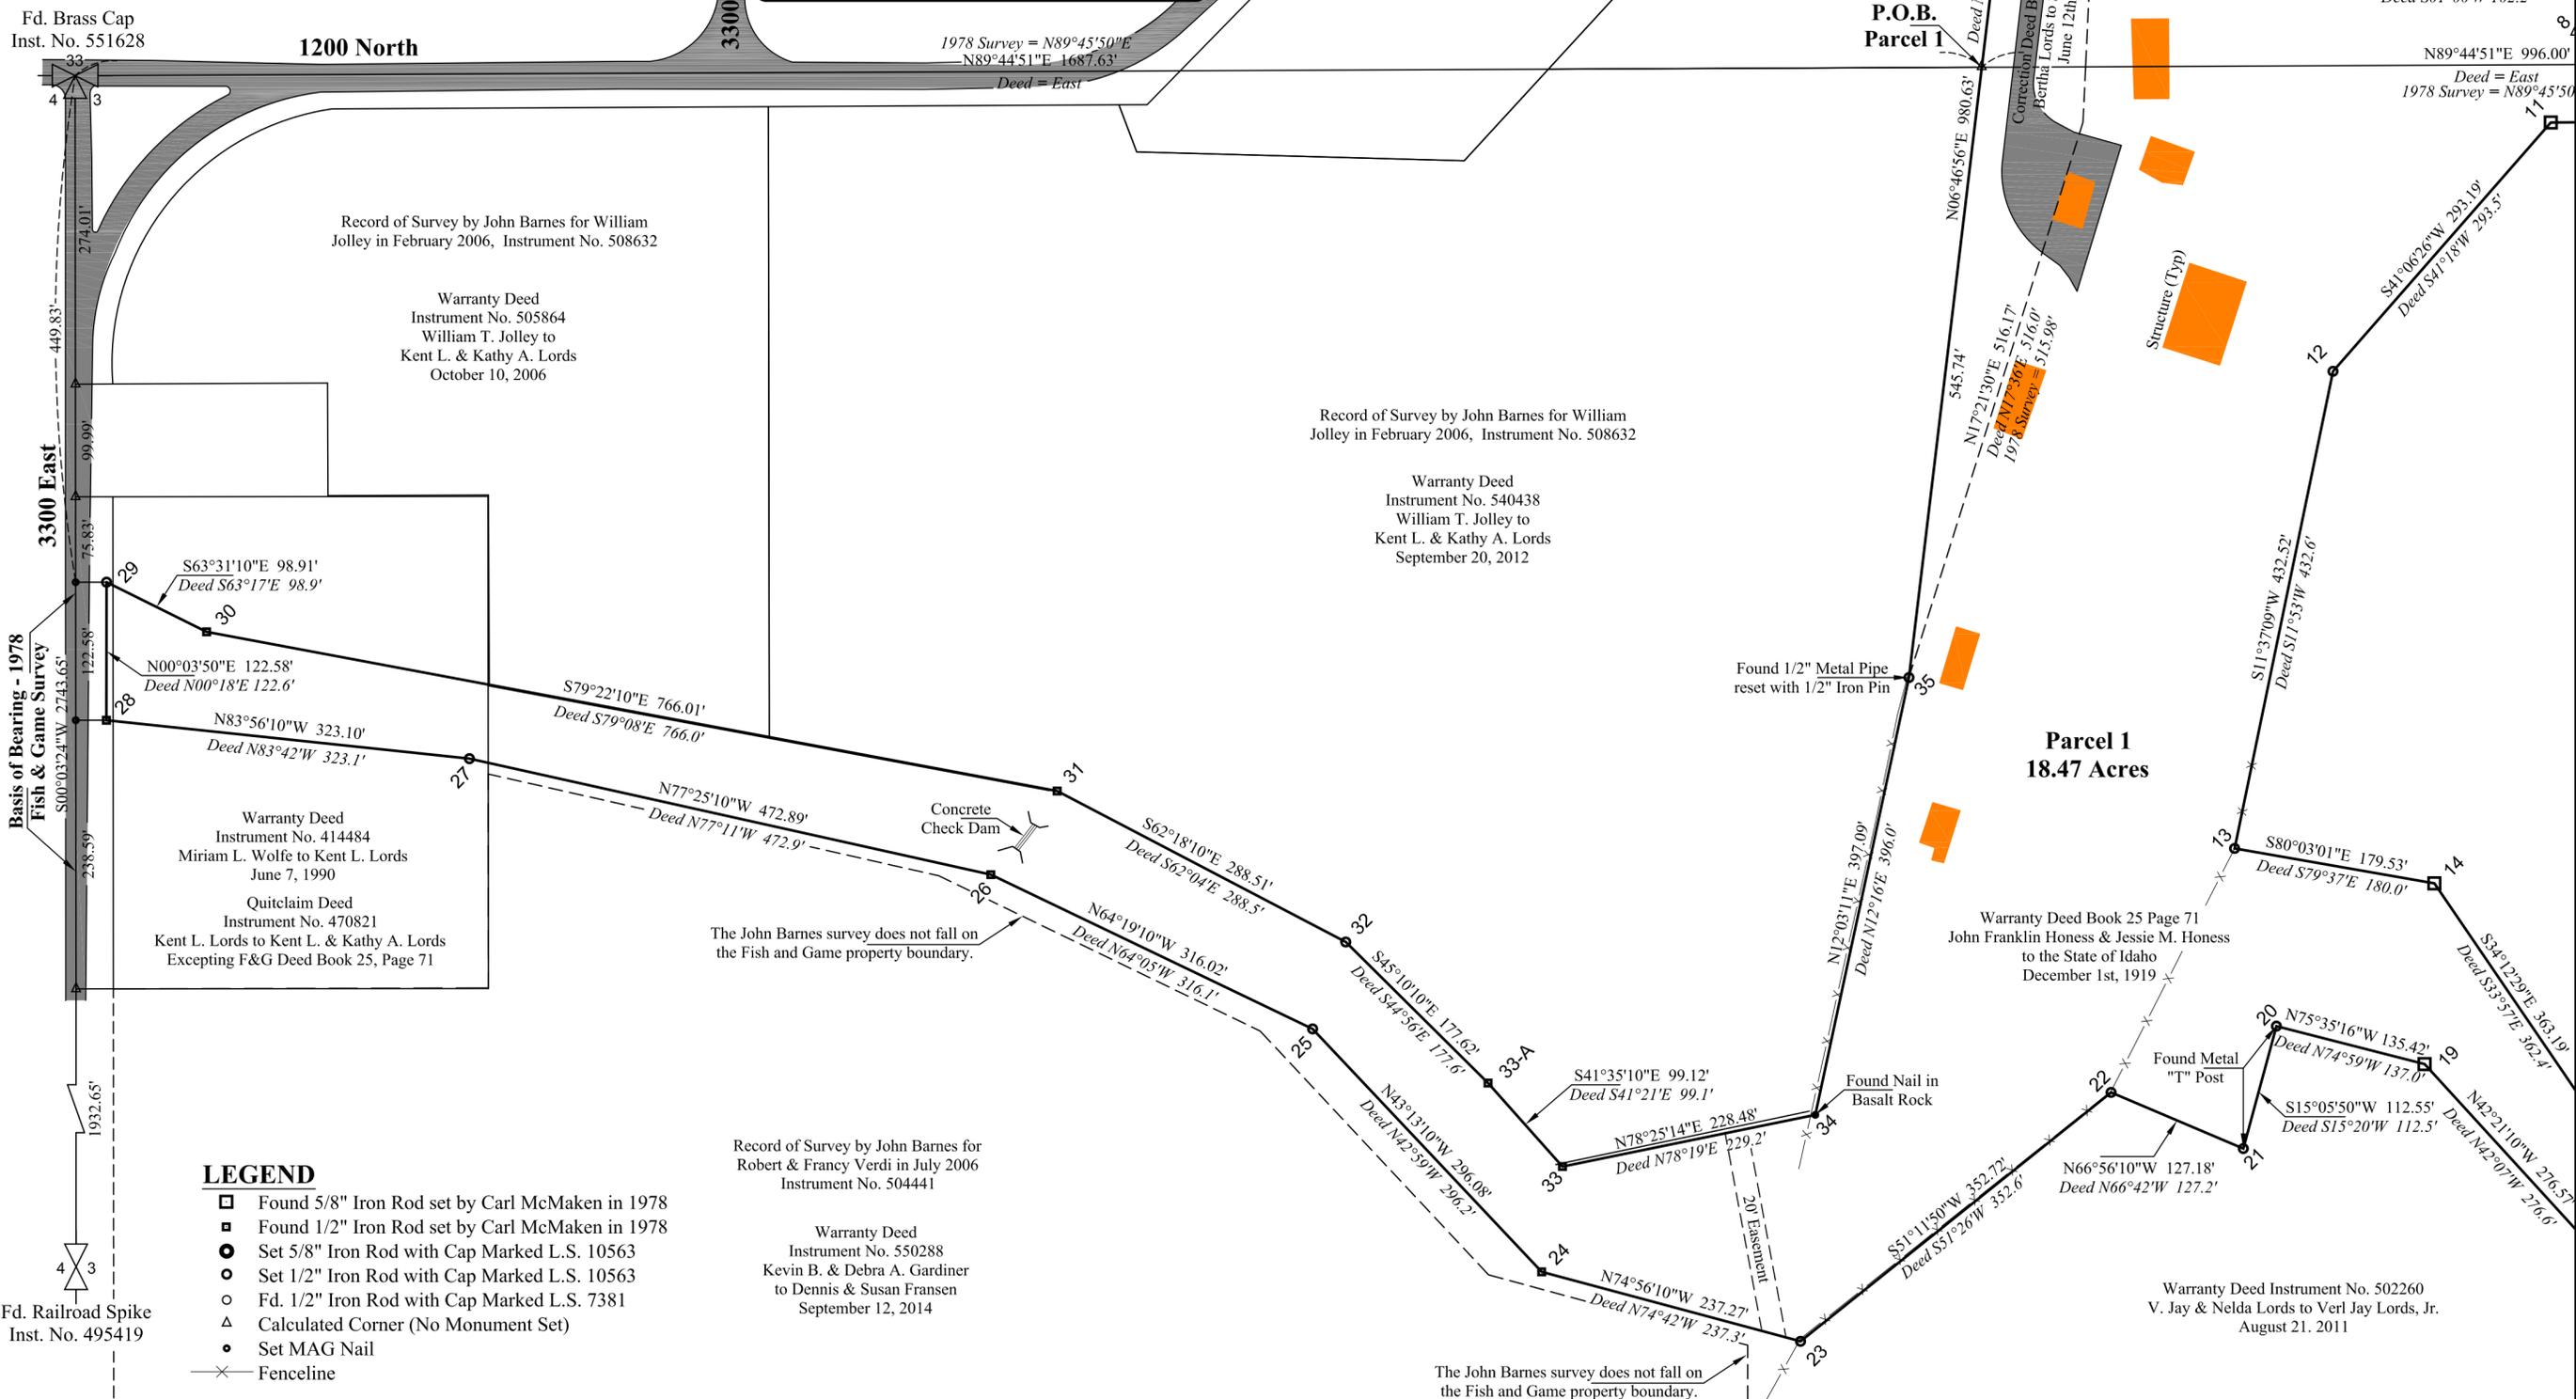


### LEGEND

- Found 5/8" Iron Rod set by Carl McMaken in 1978
- Found 1/2" Iron Rod set by Carl McMaken in 1978
- Set 5/8" Iron Rod with Cap Marked L.S. 10563
- Set 1/2" Iron Rod with Cap Marked L.S. 7381
- △ Fd. 1/2" Iron Rod with Cap Marked L.S. 7381
- ▲ Calculated Corner (No Monument Set)
- Set MAG Nail
- Fenceline

Fd. Railroad Spike  
 Inst. No. 495419

ATTACHMENT 3 \\IT\REF\Projects\2014\2014-143\Department\_Fish&Game\Record\_of\_Survey1.dwg, 12/26/2014 5:13:41 PM

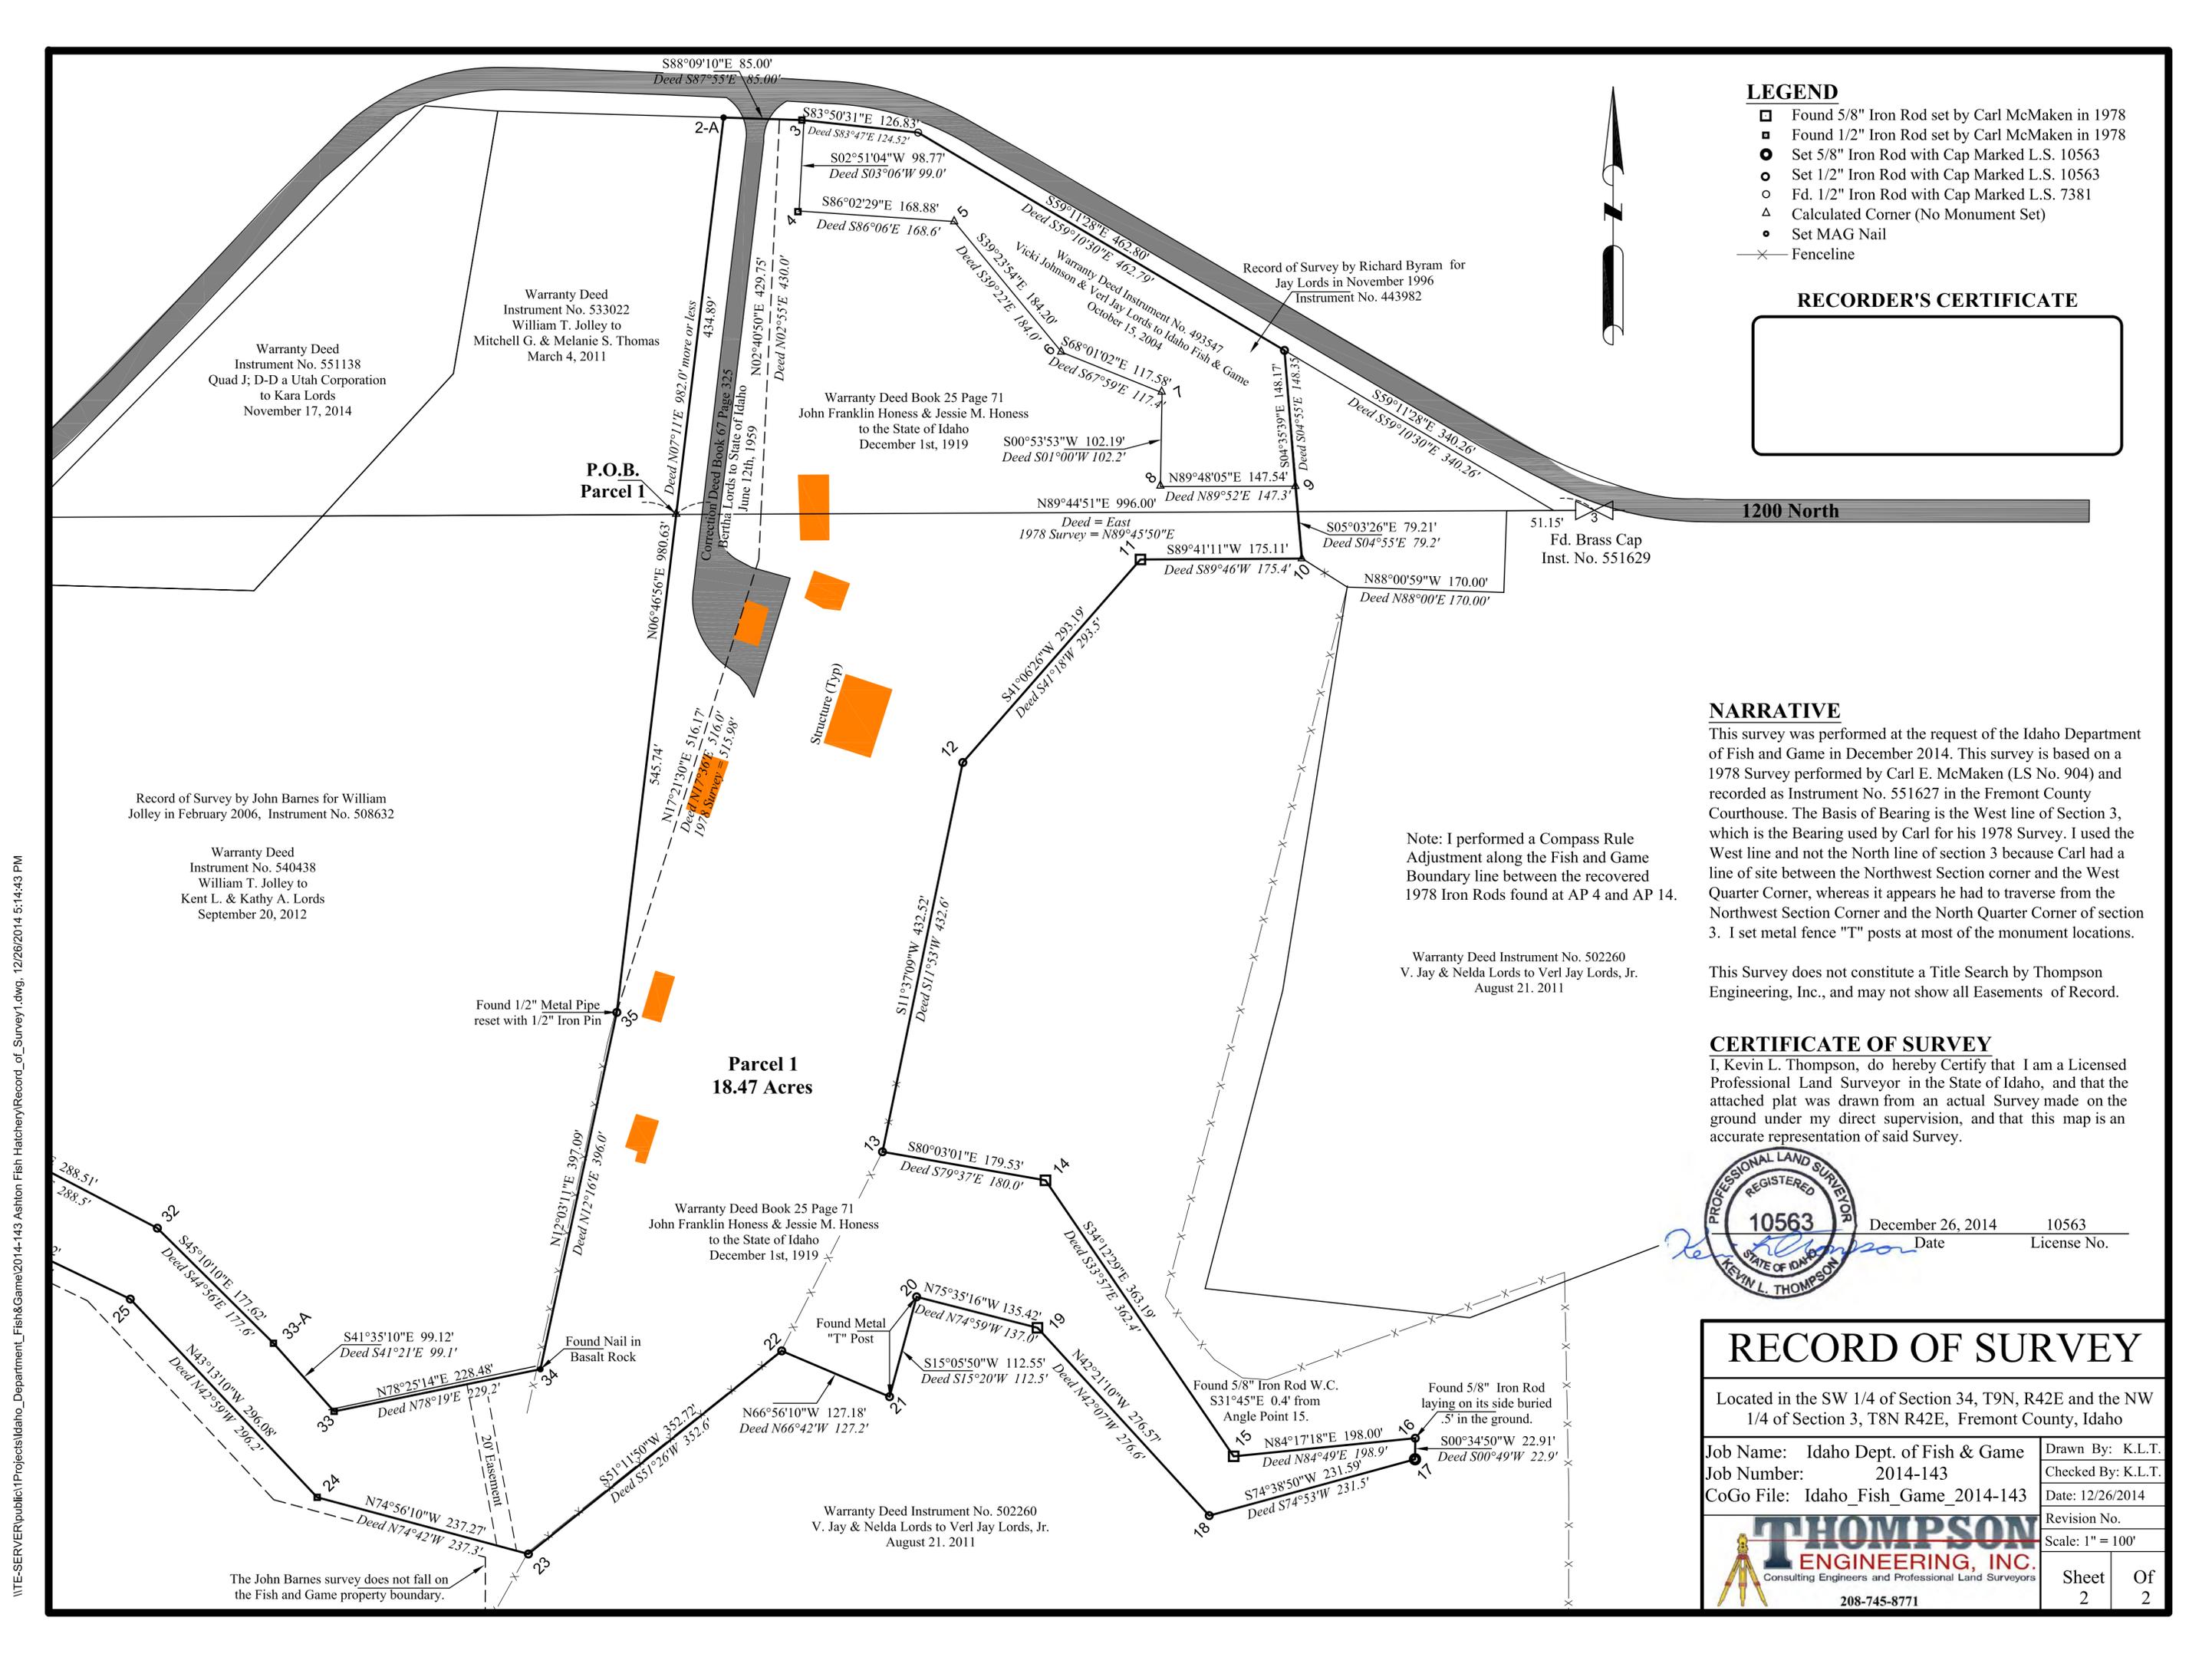

**LEGEND**

- Found 5/8" Iron Rod set by Carl McMaken in 1978
- Found 1/2" Iron Rod set by Carl McMaken in 1978
- Set 5/8" Iron Rod with Cap Marked L.S. 10563
- Set 1/2" Iron Rod with Cap Marked L.S. 10563
- Fd. 1/2" Iron Rod with Cap Marked L.S. 7381
- △ Calculated Corner (No Monument Set)
- Set MAG Nail
- Fenceline

**RECORDER'S CERTIFICATE**

Blank box for Recorder's Certificate.

**NARRATIVE**

This survey was performed at the request of the Idaho Department of Fish and Game in December 2014. This survey is based on a 1978 Survey performed by Carl E. McMaken (LS No. 904) and recorded as Instrument No. 551627 in the Fremont County Courthouse. The Basis of Bearing is the West line of Section 3, which is the Bearing used by Carl for his 1978 Survey. I used the West line and not the North line of section 3 because Carl had a line of site between the Northwest Section corner and the West Quarter Corner, whereas it appears he had to traverse from the Northwest Section Corner and the North Quarter Corner of section 3. I set metal fence "T" posts at most of the monument locations.

This Survey does not constitute a Title Search by Thompson Engineering, Inc., and may not show all Easements of Record.

**CERTIFICATE OF SURVEY**

I, Kevin L. Thompson, do hereby Certify that I am a Licensed Professional Land Surveyor in the State of Idaho, and that the attached plat was drawn from an actual Survey made on the ground under my direct supervision, and that this map is an accurate representation of said Survey.



December 26, 2014 10563  
Date License No.

**RECORD OF SURVEY**

Located in the SW 1/4 of Section 34, T9N, R42E and the NW 1/4 of Section 3, T8N R42E, Fremont County, Idaho

Job Name: Idaho Dept. of Fish & Game	Drawn By: K.L.T.
Job Number: 2014-143	Checked By: K.L.T.
CoGo File: Idaho_Fish_Game_2014-143	Date: 12/26/2014
	Revision No.
	Scale: 1" = 100'
	Sheet 2
208-745-8771	Of 2

Note: I performed a Compass Rule Adjustment along the Fish and Game Boundary line between the recovered 1978 Iron Rods found at AP 4 and AP 14.

Warranty Deed Instrument No. 502260  
V. Jay & Nelda Lords to Verl Jay Lords, Jr.  
August 21, 2011

Warranty Deed Instrument No. 551138  
Quad J; D-D a Utah Corporation to Kara Lords  
November 17, 2014

Warranty Deed Instrument No. 533022  
William T. Jolley to Mitchell G. & Melanie S. Thomas  
March 4, 2011

Warranty Deed Book 25 Page 71  
John Franklin Honess & Jessie M. Honess to the State of Idaho  
December 1st, 1919

Record of Survey by John Barnes for William Jolley in February 2006, Instrument No. 508632

Warranty Deed Instrument No. 540438  
William T. Jolley to Kent L. & Kathy A. Lords  
September 20, 2012

Found 1/2" Metal Pipe reset with 1/2" Iron Pin

**Parcel 1**  
18.47 Acres

Warranty Deed Book 25 Page 71  
John Franklin Honess & Jessie M. Honess to the State of Idaho  
December 1st, 1919

Found Metal "T" Post

Found 5/8" Iron Rod W.C. S31°45'E 0.4' from Angle Point 15.

Found 5/8" Iron Rod laying on its side buried .5' in the ground.

Warranty Deed Instrument No. 502260  
V. Jay & Nelda Lords to Verl Jay Lords, Jr.  
August 21, 2011

The John Barnes survey does not fall on the Fish and Game property boundary.